A Dimension Configurable Plates - SS400

6F Equivalent (Economy)



Top / Bottom / Width Milled
Length Precision Cut

■Features of Precision Cut Plates: Economical and short delivery time

Base material is milled on top, bottom and side surfaces for cut to precise lengths by 1mm increment for shipments. Economical and short delivery time.

RoHS10

SS400-CUT

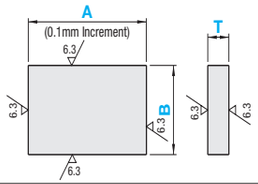

Tolerance	Reference: Length	~600mm	600.1~1200mm
	Length (A)	±0.1	±0.2
	Width (B)	±0.1	
	Thickness (T)	±0.1	

M Material: SS400

Ordering Example

Part Number	-	A	-	B	-	T
SS400-CUT	-	100	-	100	-	10

■Precision Standards (Max. Value)

Item		Condition	Standard Value
Width Parallelism		Length Min. ~ 200mm	0.03
		Length 200.1 ~ 500mm	0.05
		Length 500.1 ~ Max.	0.1
Thickness Parallelism		To Length 100mm and Width 100mm	0.05
Flatness	T5~15		0.05
	T16~25		0.04
	T26~32		0.03
Perpendicularity (Each Plane)			0.05
Circumference Chamfering		To be free of burrs. Chamfering may be about C0.1.	

SS400-CUT

Type	A: 0.1mm Increment	B \ T	5	6	8	9	10	11	12	13	14	15	16	18	19	20	22	25	28	30	32
	15 ~ 50	15											-	-	-	-	-	-	-	-	-
	50.1~ 100												-	-	-	-	-	-	-	-	-
	100.1~ 250												-	-	-	-	-	-	-	-	-
	250.1~ 400												-	-	-	-	-	-	-	-	-
	400.1~ 600												-	-	-	-	-	-	-	-	-
	600.1~ 1000												-	-	-	-	-	-	-	-	-
	1000.1~ 1200												-	-	-	-	-	-	-	-	-
	16 ~ 50	16						-		-	-			-	-	-	-	-	-	-	-
	50.1~ 100							-		-	-			-	-	-	-	-	-	-	-
	100.1~ 250							-		-	-			-	-	-	-	-	-	-	-
	250.1~ 400							-		-	-			-	-	-	-	-	-	-	-
	400.1~ 600							-		-	-			-	-	-	-	-	-	-	-
	600.1~ 1000							-		-	-			-	-	-	-	-	-	-	-
	1000.1~ 1200							-		-	-			-	-	-	-	-	-	-	-
	20 ~ 50	20															-	-	-	-	-
	50.1~ 100																-	-	-	-	-
	100.1~ 250																-	-	-	-	-
	250.1~ 400																-	-	-	-	-
	400.1~ 600																-	-	-	-	-
	600.1~ 1000																-	-	-	-	-
	1000.1~ 1200																-	-	-	-	-
	22 ~ 50	22						-		-	-			-			-	-	-	-	-
	50.1~ 100							-		-	-			-			-	-	-	-	-
	100.1~ 250							-		-	-			-			-	-	-	-	-
	250.1~ 400							-		-	-			-			-	-	-	-	-
	400.1~ 600							-		-	-			-			-	-	-	-	-
	600.1~ 1000							-		-	-			-			-	-	-	-	-
	1000.1~ 1200							-		-	-			-			-	-	-	-	-
	25 ~ 50	25																	-	-	-
	50.1~ 100																		-	-	-
	100.1~ 250																		-	-	-
	250.1~ 400																		-	-	-
	400.1~ 600																		-	-	-
	600.1~ 1000																		-	-	-
	1000.1~ 1200																		-	-	-
	30 ~ 50	30																			-
	50.1~ 100																				-
	100.1~ 250																				-
	250.1~ 400																				-
	400.1~ 600																				-
	600.1~ 1000																				-
	1000.1~ 1200																				-
	32 ~ 50	32						-		-	-			-					-	-	-
	50.1~ 100							-		-	-			-					-	-	-
	100.1~ 250							-		-	-			-					-	-	-
	250.1~ 400							-		-	-			-					-	-	-
	400.1~ 600							-		-	-			-					-	-	-
	600.1~ 1000							-		-	-			-					-	-	-
	1000.1~ 1200							-		-	-			-					-	-	-
	35 ~ 50	35																			
	50.1~ 100																				
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	38 ~ 50	38	-					-		-	-			-					-	-	-
	50.1~ 100		-					-		-	-			-					-	-	-
	100.1~ 250		-					-		-	-			-					-	-	-
	250.1~ 400		-					-		-	-			-					-	-	-
	400.1~ 600		-					-		-	-			-					-	-	-
	600.1~ 1000		-					-		-	-			-					-	-	-
	1000.1~ 1200		-					-		-	-			-					-	-	-
	40 ~ 50	40																			
	50.1~ 100																				
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	45 ~ 50	45																			
	50.1~ 100																				
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	50 ~ 100	50																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	55 ~ 100	55																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	60 ~ 100	60																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	65 ~ 100	65																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				

SS400-CUT

Type	A: 0.1mm Increment	B \ T	5	6	8	9	10	11	12	13	14	15	16	18	19	20	22	25	28	30	32
	70 ~ 100	70																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	75 ~ 100	75																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	80 ~ 100	80																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	85 ~ 100	85																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	90 ~ 100	90																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	95 ~ 100	95																			
	100.1~ 250																				
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	100~ 250	100																			
	250.1~ 400																				
	400.1~ 600																				
	600.1~ 1000																				
	1000.1~ 1200																				
	105~ 250	105	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	110~ 250	110	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	115~ 250	115	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	120~ 250	120	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	125~ 250	125	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	130~ 250	130	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	140~ 250	140	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	150~ 250	150	-	-																	
	250.1~ 400		-	-																	
	400.1~ 600		-	-																	
	600.1~ 1000		-	-																	
	1000.1~ 1200		-	-																	
	180~ 250	180	-	-		-		-	-	-											-
	250.1~ 400		-	-		-		-	-	-											-
	400.1~ 600		-	-		-		-	-	-											-
	600.1~ 1000		-	-		-		-	-	-											-
	1000.1~ 1200		-	-		-		-	-	-											-
	200~ 250	200	-	-		-		-	-	-											-
	250.1~ 400		-	-		-		-	-	-											-
	400.1~ 600		-	-		-		-	-	-											-
	600.1~ 1000		-	-		-		-	-	-											-
	1000.1~ 1200		-	-		-		-	-	-											-